

**CIMS INTERNATIONAL N.V.**

Container, cargo & marine surveyors


ON HIRE/CONDITION INSPECTION REPORT

CONTAINER NUMBER		CLIENT NAME		SURVEY DATE		LOCATION		DEPOT	
TASU 204000-0		TANKSPAN		20-7-01		ANL		A.T.R	
TANK TYPE	MANUFACTURER	SERIAL NO.	ISO TYPE		TANK	MAX	PAYLOAD	TARE	
IMO1	CONSANI	P16511	29TG		24103L	36000kg	32130kg	3870kg	
FIRST TEST	LAST 2 1/2 YR TEST	LAST 5 YR TEST	NEXT TEST DUE		CSC	MAWP	TEST		
10-97-3	12-00-3	10-97	10-08		10-08	43	63		
STWP	ST PRESS.	TANK HEAD MAT		TANK SHELL MAT		HEAD THICKNESS	SHELL THICKNESS		
6D	10 B	17441W14401		17441W14401		5.9MM	4.6MM		

GENERAL CONDITION FRAME:

CLADDING:

PAINT:

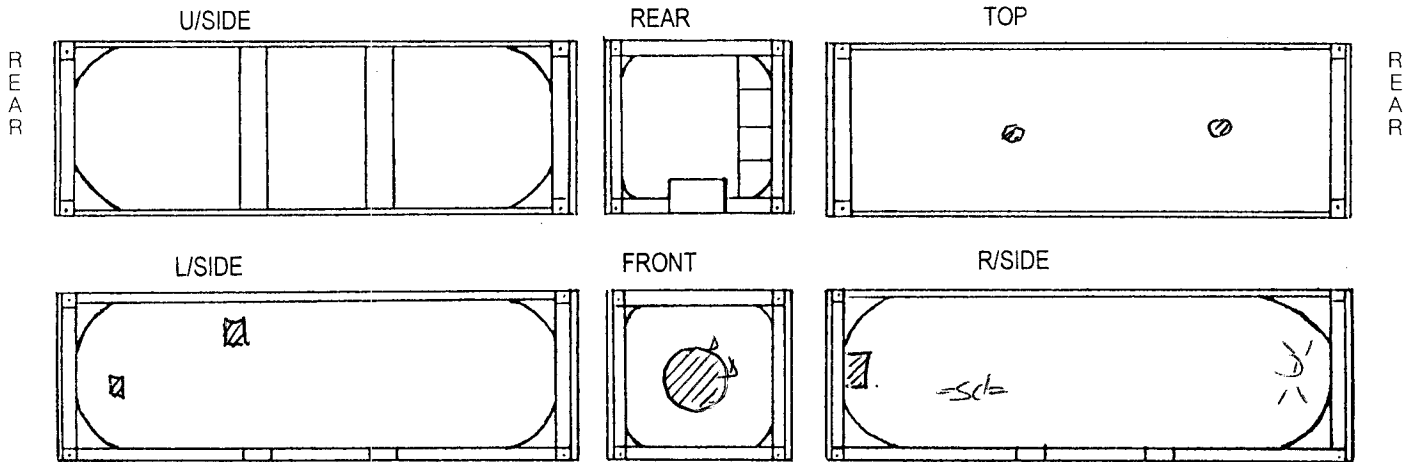

DAMAGE CODES

- B Bent     C Cut     D Dent     CR Cracked     EZ Exist. Rep.     H Hole
- COR Corrosion     L Loose     SC Scratched     M Missing     ST Stained     IR Improper Repair

COMPONENT CHECK LIST	FITTED		COMMENTS
	Y	N	
MARKINGS AND PLATES			
Data plates	✓		
Owners plate	✓		
Manufacturer's plate	✓		
CSC plate	✓		
Custom approval plate	✓		
Prefix number	✓		
IMO/DOT E number	✓		
Country code		✓	
Owner label	✓		
AAR 600	✓		
ETC impact approval	✓		
Weight / volume decals	✓		

TANK CONTAINER NO.: TAW 20h.000.0

COMPONENT CHECK LIST	FITTED		COMMENTS
	Y	N	
EXTERNAL ACCESSORIES			
Front ladder		✓	
Rear ladder	✓		
Document. Box/Cap/Gask/Chain	✓		Plastic RUS
Outlet Cap/Blank/Gask/Chain	✓		Size 3" BSP AL/SS cap
Bottom outlet valve/gaskets	✓		MFR FVI Perolo Butterfly/Ball 3x spacer
Footvalve	✓		MFR FVI " "
Remote footvalve control	✓		
Steam Tubes/Cap/Gask/Chain	✓		Size 2x 3/4" AL/SS 2x
Thermometer	✓		MFR WEC C-F 200-400
Walkway	✓		
Manhole Protection Cover	✓		
Spillbox	✓		CLEAN
Manlid / Seal	✓		SWR/PTFE
Manlid swing bolts	✓		4-6 (8) Bolted
Dipstick	✓		>
Calibration Chart	✓		2x SS.
Safety Dev.Prot.Cover/Spillbox	✓		
EXTERNAL ACCESSORIES			
P/V Relief valves 1	✓		MFR FVI Perolo Ser 116796 Vac - Press 4.4 BAR
P/V Relief valves 2	✓		MFR FVI ISANUK Ser Vac Press
Pressure Gauges		✓	MFR Range
Flame Traps on P/V Rel. Val.		✓	
Air Line Cap/Gasket/Blank/CH	✓		Size 1/2" RSP AL/SS cap
Air Line Valve/Gasket/Gauge	✓		MFR Range
Top Disch. Prot. Cover/Spillb.	✓		CLEAN
Top Disch. Valve		✓	MFR Butterfly/Ball
Top Disch. Blank/Gas.	✓		
Top Operated Int. Footvalve		✓	
Tir strips bottom/top	✓		
INTERNAL CONDITION			
Cleaned / Dry	✓		
Discoloured		✓	
Rusted		✓	
Corroded		✓	
Pitted/Lamination Pitting		✓	
Thermometer probe		✓	
Valv. Clean fm. Moist/Res.	✓		
Siphon tube		✓	
Footvalve	✓		
Bursting discs		✓	MFR 0 Range
Cleanliness certificate	✓		C.M.S 20.7.01

REMARKS: There's


---



---



---
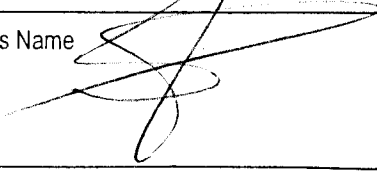
<input checked="" type="checkbox"/> Accepted <input type="checkbox"/> Rejected	Surveyor's Name 
---	--

# INTERNAL INSPECTION REPORT

TANK SERIAL NO. TACU 24000-0

LAST PRODUCT: WINE

Location: ATA. Antwerp.


Ref. No.

Inspected By: CC


Order No.

Date: 20-7-01

## FRONT

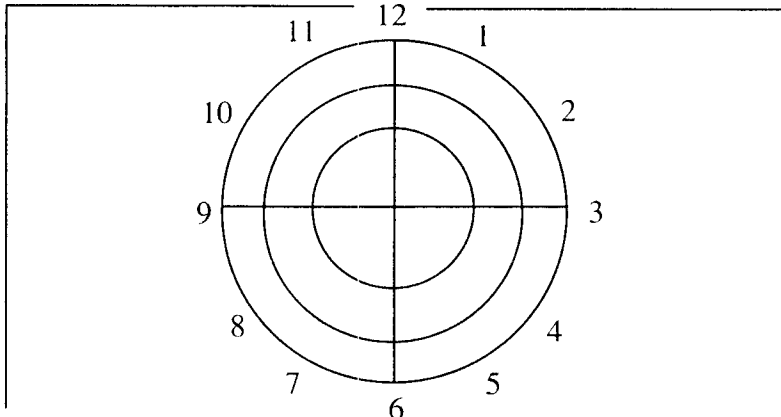

	12	11	10	9	8	7	6	5	4	3	2	1	
A													A
B													B
C													C
D													D
E													E
F													F
G													G
H													H

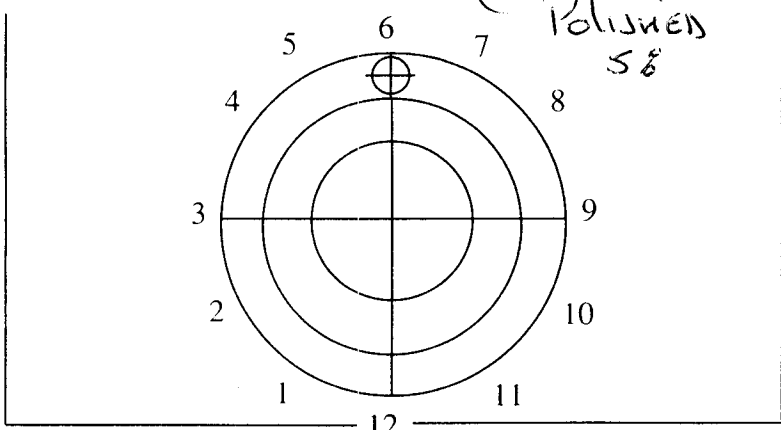

## REAR

Name (Print) ..... Carpegnat ..... Signed .....

ADDITIONAL COMMENTS  
  
 Date 20-7-01

### SURFACE CONDITION

- STAINING
- SURFACE RUST
- SURFACE SCORING  
(Scratch/gouge marks)
- PITTING

**INDICATE TYPE & SHAPE**  
 See Note II of Section 9 on Corrosion  
 Pitting in ACC.

DRAW PITTING TYPE or indicate A, B or C.

DRAW PITTING SURFACE SHAPE (Circular, elongated, etc.)

Pitting depth Average mm/inch  
 Pitting depth Maximum mm/inch

Area of shell affected %

Pitting in weld bead Y/N

Is pitting light or heavy L/H

Pitting in heat zone of weld bead Y/N

Is pitting light or heavy L/H

If tank is stained indicate colour

Condition of syphon tube

Indicate weld seam in plan



**CIMS INTERNATIONAL N.V.**  
**Container, cargo & marine surveyors**

Worldwide  
 Headquarters

Noorderlaan 115, B-2030 Antwerpen 3  
 Tel. (03) 542 03 15 Fax (03) 542 54 81 E-mail cimswwhq@cims-surveys.com

TANK CONTAINER CLEANLINESS / SAFETY CERTIFICATE

Container no. : ASU 20400-0 Tank type : IM01

Premises : ATR - ANTWERP

Last product : WINE

Date and time of inspection : 20-7-01 at 16.15 hrs

OXYGEN % 21  
 LEL % 0

SAFE FOR MEN - SAFE FOR FIRE

DRY - ODOURLESS

SHELL SURFACE CLEAN (visual examination only)

MANHOLE GASKET CLEAN

TOP DISCHARGE VALVE / SYPHON TUBE CLEAN

BOTTOM DISCHARGE VALVE CLEAN

~~YES/NO~~  
~~YES/NO~~  
~~YES/NO~~  
~~YES/NO~~  
~~YES/NO~~  
~~YES/NO~~

REMARKS

-----

NAME OF INSPECTOR :

-----

This report refers to the condition of the tankcontainer at time of inspection only.

All orders are executed only in accordance with our General Conditions deposited with the Antwerp Chamber of Commerce and Industry.

















