

**CIMS INTERNATIONAL N.V.**

Container, cargo & marine surveyors


**INSPECTION REPORT**

CONTAINER NUMBER		CLIENT NAME		SURVEY DATE		LOCATION		DEPOT	
TASH 914145-6		TANKSPAN		13-07-01		HULL		H+P	
TANK TYPE	MANUFACTURER	SERIAL NO.	ISO TYPE		TANK	MAX	PAYLOAD	TARE	
1M01	FRUEHAUF	15/1213	22T6		24000 LTRS	32000 KGS		4080 KGS	
FIRST TEST	LAST 2 1/2 YR TEST	LAST 5 YR TEST	NEXT TEST DUE		CSC	MAWP	TEST		
07-93	1-99	02-01	08-03		ACEP.	4	6		
STWP	ST PRESS.	TANK HEAD MAT		TANK SHELL MAT		HEAD THICKNESS	SHELL THICKNESS		
4 BAR	6 BAR	AISI 316		AISI 316		6.08 mm	4.7 mm		

GENERAL CONDITION FRAME:  
**GOOD/REFURBISHED**

CLADDING:  
**GOOD**

PAINT:  
**GOOD**

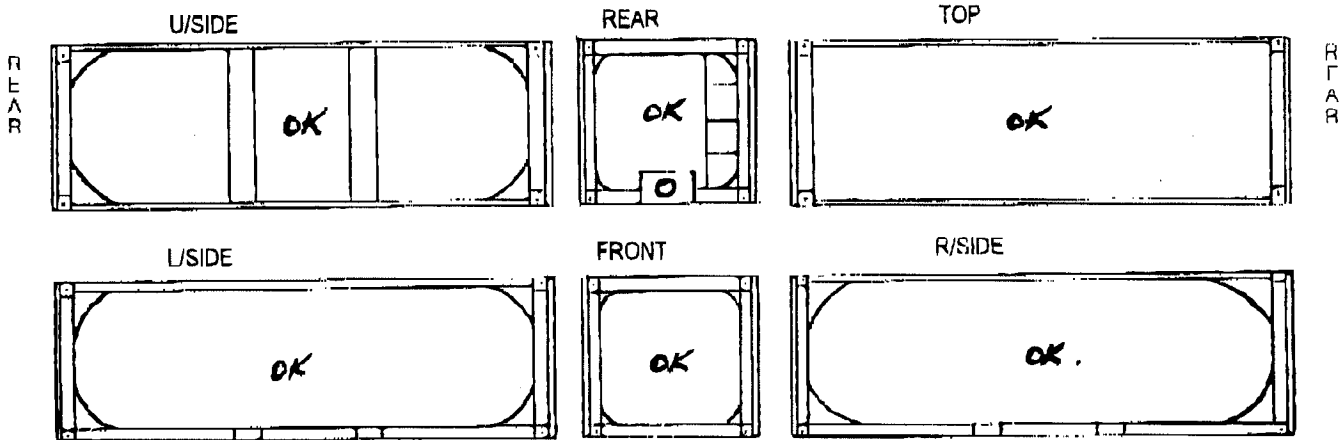

**DAMAGE CODES**

- B Bent
- C Cut
- D Dent
- CR Cracked
- EZ Exist. Rep.
- H Hole
- COR Corrosion
- L Loose
- SC Scratched
- M Missing
- ST Stained
- IR Improper Repair

COMPONENT CHECK LIST	FITTED		COMMENTS
	Y	N	
MARKINGS AND PLATES			
Data plates	/		
Owners plate	/		
Manufacturer's plate	/		
CSC plate	/		
Custom approval plate	/		
Prefix number	/		
IMO/DOT E number	/		
Country code	/		
Owner label	/		
AAR 600	/		
CTC Impact approval	/		
Weight / volume decals	/		

TANK CONTAINER NO. : Tan 914145-6

COMPONENT CHECK LIST	FITTED		COMMENTS
	Y	N	
EXTERNAL ACCESSORIES			
Front ladder		X	
Rear ladder	/		
Document. Box/Cap/Gask/Chain	/		
Outlet Cap/Blank/Gask/Chain	/		Size <u>3" BSP</u> ALU/SS
Bottom outlet valve/gaskets	/		MFR FVI / Butterfly/Ball
Footvalve	/		MFR FVI /
Remote footvalve control	/		
Steam Tubes/Cap/Gask/Chain	/		Size <u>1" BSP</u> ALU/SS
Thermometer	/		MFR <u>N/A</u> C-F /
Walkway	/		
Manhole Protection Cover		X	
Spillbox	/		
Manlid / Seal	/		<del>SS</del> /PTFE
Manlid swing bolts	/		<u>4-6 (B)</u> - Bolted
Dipstick		X	
Calibration Chart	/		
Safety Dev Prot Cover/Spillbox		X	
EXTERNAL ACCESSORIES			
P/V Relief valves 1	/		MFR FVI / Ser <u>9414659</u> Vac <u>6" NG</u> Press <u>4.4 BAR</u>
P/V Relief valves 2	/		MFR FVI / Ser <u>9414651</u> Vac <u>6" NG</u> Press <u>4.4 BAR</u>
Pressure Gauges		X	MFR Range
Flame Traps on P/V Rel. Val.	/		
Air Line Cap/Gasket/Blank/CH	/		Size <u>1 1/2" BSP</u> <del>SS</del> /SS
Air Line Valve/Gasket/Gauge	/		MFR <u>FV</u> Range <u>10 BAR</u>
Top Disch. Prot. <del>Cover</del> /Spillb.	/		
Top Disch. Valve		X	MFR Butterfly/Ball
Top Disch. Blank/Gas	/		
Top Operated Int. Footvalve		X	
Tir strips bottom/top	/		
INTERNAL CONDITION			
Cleaned / Dry	/		
Discoloured		X	
Rusted		X	
Corroded		X	
Pitted/Lamination Pitting		X	
Thermometer probe		X	
Valv. Clean fm. Mois/Res.	/		
Siphon tube		X	
Footvalve	/		
Bursting discs		X	MFR Range
Cleanliness certificate		X	

REMARKS: Satisfactory Refurbishment - photos

<input checked="" type="checkbox"/> Accepted <input type="checkbox"/> Rejected	Surveyor's Name <u>H. Conley</u>
-----------------------------------------------------------------------------------	-------------------------------------

TANKSPAN LTD  
From: MIKE MIDDLETON 01482 701722

H&P HULL  
25/04/01 17:29:50 Page 1 of 1



**H & P Freightways Limited**

1203 Hedon Road, Hull, HU9 5LY, England  
Tel: 01482 702185 Fax 01482 708323

F.A.C.            ANDREW MILLS            TANKSPAN LEASING LTD.  
  
FROM            MIKE MIDDLETON            H&P FREIGHTWAYS LTD.  
  
DATE            25.04.01  
  
REF            FULL REFURBISHMENTS (AS PER SPECIFICATION 25.04.01)

DEAR ANDREW

PLEASE APPROVE FOLLOWING COSTS FOR REFURBISHMENTS TO BE CARRIED OUT AT  
H&P FREIGHTWAYS HULL AS DISCUSSED AT OUR MEETING WEDNESDAY 25.04.01

TASU 914145/6            £4819.60

**TANKSPAN LEASING LIMITED**

*AM*  
25/4/01

BEST REGARDS

MIKE

TASU 914145-6

<b>C. I. M. S. INTL.</b>	
<b>POST REPAIRS</b>	
<b>REPAIRS CARRIED OUT AS ESTIMATED <b>YES</b></b>	
<b>SURVEYOR:</b>	<b>DATE:</b>

*K. Conley*            13/07/01.

Depots: Felixstowe Tel: 01394 674021. Manchester Tel: 0161 888 2207 Teesport Tel: 01642 454134  
All business undertaken by us is in accordance with the terms of the Standard Trading Conditions of the Company.  
Copies supplied on request. Registered No. 2571574 England VAT Reg. No. GB 551 9635 25



















