

**CIMS INTERNATIONAL N.V.**

Container, cargo & marine surveyors

ON HIRE/CONDITION INSPECTION REPORT


CONTAINER NUMBER		CLIENT NAME		SURVEY DATE		LOCATION		DEPOT	
ICTU 250047-0		TANKSPAN		24-09-01		3DN		BACONUSA	
TANK TYPE	MANUFACTURER	SERIAL NO.	ISO TYPE		TANK	MAX	PAYLOAD	TARE	
IMO 1	GEA	3408	22TG		25000L	36000kg	32020kg	3980kg	
FIRST TEST	LAST 2 1/2 YR TEST		LAST 5 YR TEST		NEXT TEST DUE		CSC	MAWP	TEST
04-99	-		04-99		10-01		04-04	4B	6B
STWP	ST PRESS.	TANK HEAD MAT		TANK SHELL MAT		HEAD THICKNESS		SHELL THICKNESS	
6B	9B	17441 17440		17441 17440		6.0 MM		4.5 MM	

GENERAL CONDITION FRAME:

CLADDING:

PAINT:

*Frame + Cladding slightly stained*

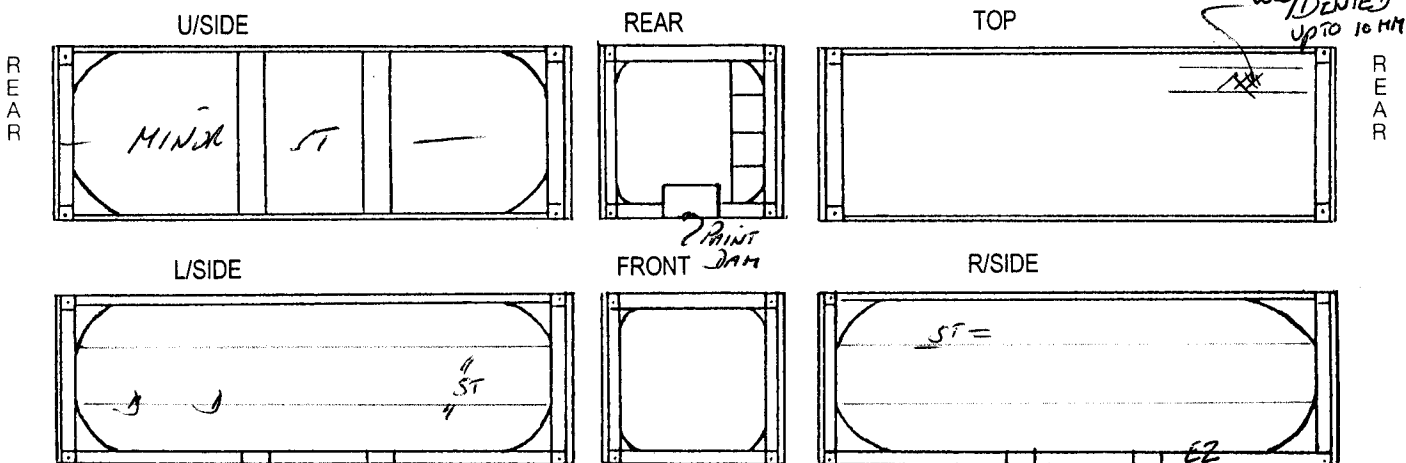


DAMAGE CODES

- B Bent       C Cut       D Dent       CR Cracked       EZ Exist. Rep.       H Hole
- COR Corrosion       L Loose       SC Scratched       M Missing       ST Stained       IR Improper Repair


COMPONENT CHECK LIST	FITTED		COMMENTS
	Y	N	
MARKINGS AND PLATES			
Data plates	✓		
Owners plate	✓		
Manufacturer's plate	✓		
CSC plate	✓		
Custom approval plate	✓		
Prefix number	✓		
IMO/DOT E number	✓		
Country code		✓	
Owner label		✓	
AAR 600	✓		
ETC impact approval	✓		
Weight / volume decals	✓		

COMPONENT CHECK LIST	FITTED		COMMENTS
	Y	N	
EXTERNAL ACCESSORIES			
Front ladder		✓	
Rear ladder	✓		
Document. Box/Cap/Gask/Chain	✓		Classic LHS
Outlet Cap/Blank/Gask/Chain	✓		Size 3" BSP ALU/SS CAP
Bottom outlet valve/gaskets	✓		MFR FVI TERO 6 Butterfly/Ball 3x spacer
Footvalve	✓		MFR FVI " "
Remote footvalve control	✓		
Steam Tubes/Cap/Gask/Chain	✓		Size 9x 3/4" ALU/SS 2x Classic cap
Thermometer	✓		MFR TWA C-F 160-320
Walkway	✓		
Manhole Protection Cover		✓	
Spillbox	✓		
Manlid / Seal	✓		SWR/PTFE
Manlid swing bolts	✓		4-6 (8) Bolted
Dipstick		✓	
Calibration Chart	✓		
Safety Dev.Prot.Cover/Spillbox	✓		
EXTERNAL ACCESSORIES			
P/V Relief valves 1	✓		MFR (FV) Ser 9221097 Vac 6.2 MPa Press 6.4 BAR
P/V Relief valves 2		✓	MFR FVI Blank Ser Vac Press
Pressure Gauges		✓	MFR Range
Flame Traps on P/V Rel. Val.	✓		1x
Air Line Cap/Gasket/Blank/CH	✓		Size 1/2" BSP ALU/SS CAP
Air Line Valve/Gasket/Gauge	✓		MFR WILK Range 7 BAR
Top Disch. Prot. Cover/Spillb.	✓		
Top Disch. Valve		✓	MFR Butterfly/Ball
Top Disch. Blank/Gas.	✓		
Top Operated Int. Footvalve		✓	
Tir strips bottom/top	✓		
INTERNAL CONDITION			
Cleaned / Dry	✓		
Discoloured		✓	
Rusted		✓	
Corroded		✓	
Pitted/Lamination Pitting		✓	
Thermometer probe		✓	
Valv. Clean fm. Moist/Res.	✓		
Siphon tube		✓	
Footvalve	✓		
Bursting discs		✓	MFR Range
Cleanliness certificate	✓		Cinis 24-09-01

REMARKS: Photo's taken
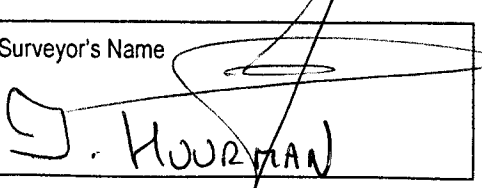
<input checked="" type="checkbox"/> Accepted <input type="checkbox"/> Rejected	Surveyor's Name  J. HOURMAN
---	---



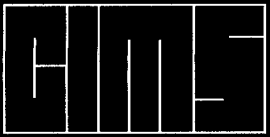

**CIMS INTERNATIONAL N.V.**  
 Container, cargo & marine surveyors

Worldwide  
 Headquarters

Noorderlaan 115, B-2030 Antwerpen 3  
 Tel. (03) 542 03 15 Fax (03) 542 54 81 E-mail cimswwhq@cims-surveys.com

**TANK CONTAINER CLEANLINESS / SAFETY CERTIFICATE**

Container no. : ICTU 250047-0 Tank type : IMO1  
 Premises : BCN - Spain  
 Last product : Dipropylene Glycol  
 Date and time of inspection : 24-09-01 at 13.50 hrs

OXYGEN %	<u>21</u>	
LEL %	<u>0</u>	
SAFE FOR MEN - SAFE FOR FIRE		YES/NO
DRY - ODOURLESS		YES/NO
SHELL SURFACE CLEAN (visual examination only)		YES/NO
MANHOLE GASKET CLEAN		YES/NO
TOP DISCHARGE VALVE / SYPHON TUBE CLEAN		YES/NO
BOTTOM DISCHARGE VALVE CLEAN		YES/NO

**REMARKS**

-----

NAME OF INSPECTOR : J. HUMAN

This report refers to the condition of the tankcontainer at time of inspection only.

All orders are executed only in accordance with our General Conditions deposited with the Antwerp Chamber of Commerce and Industry.



