

CIMS INTERNATIONAL N.V.

Container, cargo & marine surveyors


ON HIRE/CONDITION INSPECTION REPORT

CONTAINER NUMBER		CLIENT NAME		SURVEY DATE		LOCATION		DEPOT	
IASU 1141589		ANKSPAN		08.04.08		ANL		A.T.R	
TANK TYPE	MANUFACTURER	SERIAL NO.	ISO TYPE	TANK	MAX	PAYLOAD	TARE		
IMO 1	U.O	8559	22T6	24060L	34000kg	29800kg	4200kg		
FIRST TEST	LAST 2 1/2 YR TEST	LAST 5 YR TEST	NEXT TEST DUE		CSC	MAWP	TEST		
02/97	-	04/01	10/03		10/03	43	63		
STWP	ST PRESS.	TANK HEAD MAT		TANK SHELL MAT		HEAD THICKNESS	SHELL THICKNESS		
43	63	17460 W 14401		17461 W 14401		6,24 MM	4,8 MM		

GENERAL CONDITION FRAME:

CLADDING:

PAINT:

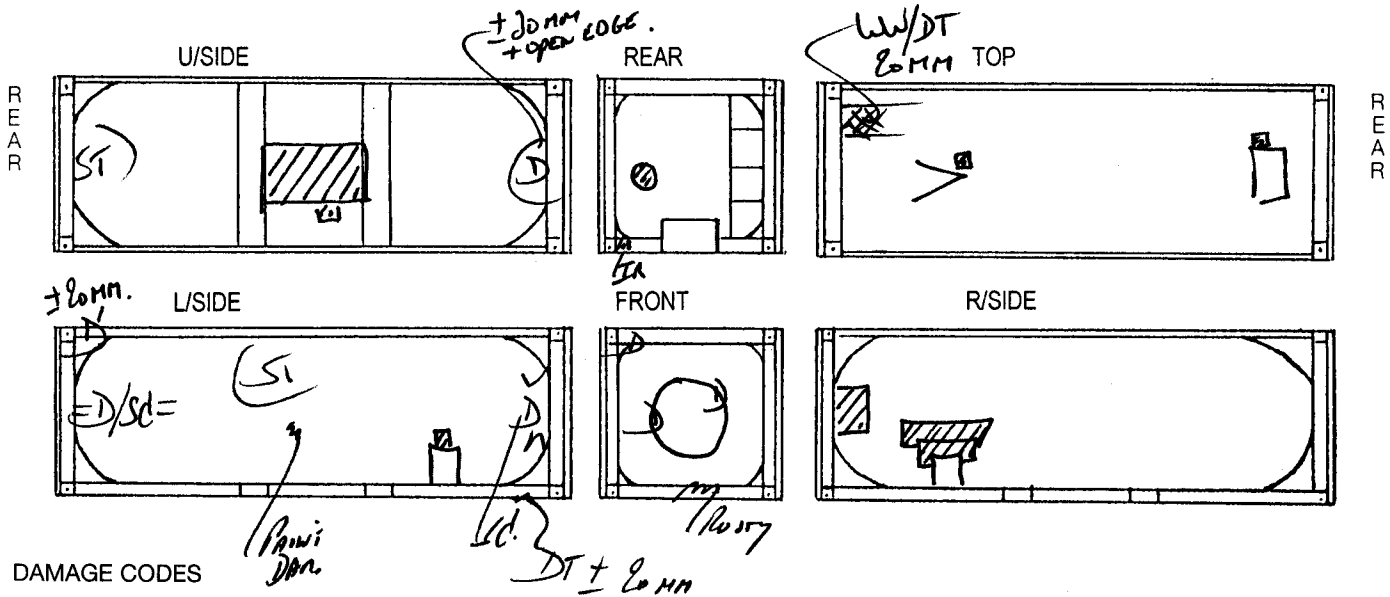


DAMAGE CODES

- B Bent
- C Cut
- D Dent
- CR Cracked
- EZ Exist. Rep.
- H Hole
- COR Corrosion
- L Loose
- SC Scratched
- M Missing
- ST Stained
- IR Improper Repair

COMPONENT CHECK LIST	FITTED		COMMENTS
	Y	N	
MARKINGS AND PLATES			
Data plates	✓		
Owners plate	✓		
Manufacturer's plate	✓		
CSC plate	✓		
Custom approval plate	✓		
Prefix number	✓		
IMO/DOT E number	✓		
Country code	✓		
Owner label	✓		US/US sc Partly Peeling off.
AAR 600	✓		
OTC impact approval	✓		
Weight / volume decals	✓		

COMPONENT CHECK LIST	FITTED		COMMENTS
	Y	N	
EXTERNAL ACCESSORIES			
Front ladder		✓	
Rear ladder	✓		
Document. Box/Cap/Gask/Chain	✓		PLASTIC REAR
Outlet Cap/Blank/Gask/Chain	✓		Size 3" BSP. ALU/SS CAP
Bottom outlet valve/gaskets	✓		MFR (FVI) Butterfly/Ball No SPACERS
Footvalve	✓		MFR (FVI)
Remote footvalve control	✓		
Steam Tubes/Cap/Gask/Chain	✓		Size 2 x 3/4" ALU/SS 2x + VALVE
Thermometer	✓		MFR WEISS C-F No. 250
Walkway	✓		
Manhole Protection Cover		✓	
Spillbox	✓		MINOR BLACK PRODUCT LEFT IN GRINDINGS!
Manlid / Seal	✓		SWR/PTFE
Manlid swing bolts	✓		4-6 (8) Bolted
Dipstick		✓	SUPPORT EXT. OUT
Calibration Chart	✓		1x SET
Safety Dev. Prot. Cover/Spillbox	✓		
EXTERNAL ACCESSORIES			
P/V Relief valves 1	✓		MFR (FVI) Ser 9651402 Vac 649 Press 44 BAR
P/V Relief valves 2		✓	MFR FVI Ser BLANK Vac Press
Pressure Gauges		✓	MFR Range
Flame Traps on P/V Rel. Val.	✓		1x EXT.
Air Line Cap/Gasket/Blank/CH	✓		Size 1 1/2" ALU/SS CAP
Air Line Valve/Gasket/Gauge	✓		MFR Range CONDENS!
Top Disch. Prot. Cover/Spillb.	✓		CLEAN
Top Disch. Valve		✓	MFR Butterfly/Ball
Top Disch. Blank/Gas.	✓		
Top Operated Int. Footvalve		✓	
Tir strips bottom/top	✓		
INTERNAL CONDITION			
Cleaned / Dry	✓		
Discoloured		✓	
Rusted		✓	
Corroded		✓	
Pitted/Lamination Pitting		✓	
Thermometer probe		✓	
Valv. Clean fm. Moist/Res.	✓		
Siphon tube		✓	
Footvalve	✓		
Bursting discs		✓	MFR Range
Cleanliness certificate	✓		CIN 08.09.02

REMARKS : PHOTOS TAKEN

<input checked="" type="checkbox"/> Accepted <input type="checkbox"/> Rejected	Surveyor's Name 
---	---

INTERNAL INSPECTION REPORT

TANK SERIAL NO. *Vasv M458-9*

LAST PRODUCT: *Trimethylol Propane*

Location: *A.T.R. Antwerp*


Ref. No.

Inspected By: *ER*

Order No.


Date: *04/04/02*

FRONT

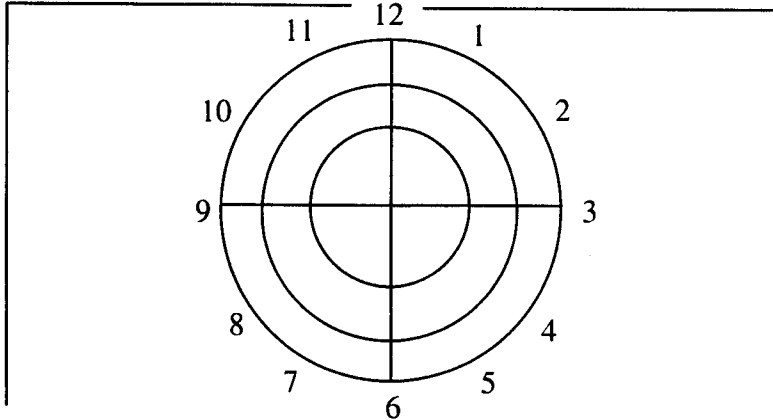

	12	11	10	9	8	7	6	5	4	3	2	1	
A													A
B													B
C													C
D													D
E													E
F													F
G													G
H													H

100%
POLISHED

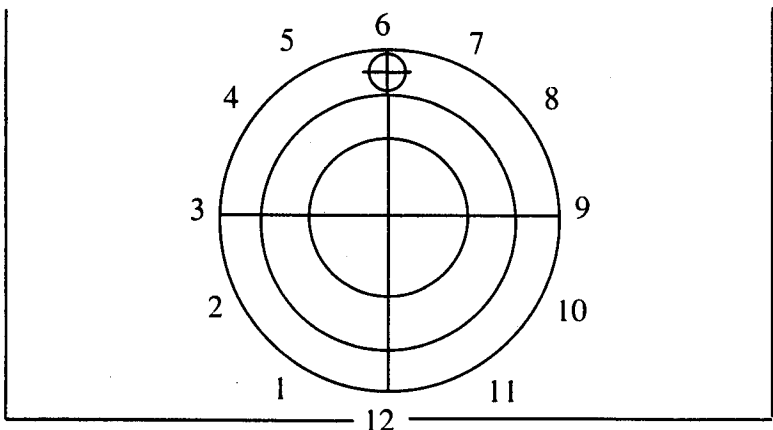

REAR

SURFACE CONDITION

- STAINING
- SURFACE RUST
- SURFACE SCORING (Scratch/gouge marks)
- PITTING

INDICATE TYPE & SHAPE
See Note II of Section 9 on Corrosion
Pitting in ACC.

DRAW PITTING TYPE or indicate A,B or C.

DRAW PITTING SURFACE SHAPE (Circular, elongated, etc.)

Pitting depth Average mm/inch
Pitting depth Maximum mm/inch

Area of shell affected %

Pitting in weld bead Y/N

Is pitting light or heavy L/H

Pitting in heat zone of weld bead Y/N

Is pitting light or heavy L/H

If tank is stained indicate colour

Condition of syphon tube

Indicate weld seam in plan

ADDITIONAL COMMENTS

Name (Print)


ER

Signed

[Signature]

Date

04/04/02

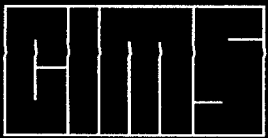

CIMS INTERNATIONAL N.V.
 Container, cargo & marine surveyors

Worldwide
 Headquarters

Noorderlaan 115, B-2030 Antwerpen 3
 Tel. (03) 542 03 15 Fax (03) 542 54 81 E-mail cimswwhq@cims-surveys.com

TANK CONTAINER CLEANLINESS / SAFETY CERTIFICATE

Container no. : ASU 414158-9 Tank type : IMO1
 Premises : A.T.R. - ANTWERP
 Last product : TRIMETHYLOLPROPANE
 Date and time of inspection : 08.04.02 at 16⁰⁰ hrs


OXYGEN %	<u>21</u>	
LEL %	<u>0</u>	
SAFE FOR MEN - SAFE FOR FIRE		YES/NO
DRY - ODOURLESS		YES/NO
SHELL SURFACE CLEAN (visual examination only)		YES/NO
MANHOLE GASKET CLEAN		YES/NO
TOP DISCHARGE VALVE / SYPHON TUBE CLEAN		YES/NO
BOTTOM DISCHARGE VALVE CLEAN		YES/NO

REMARKS

NAME OF INSPECTOR :

This report refers to the condition of the tankcontainer at time of inspection only.

All orders are executed only in accordance with our General Conditions deposited with the Antwerp Chamber of Commerce and Industry.

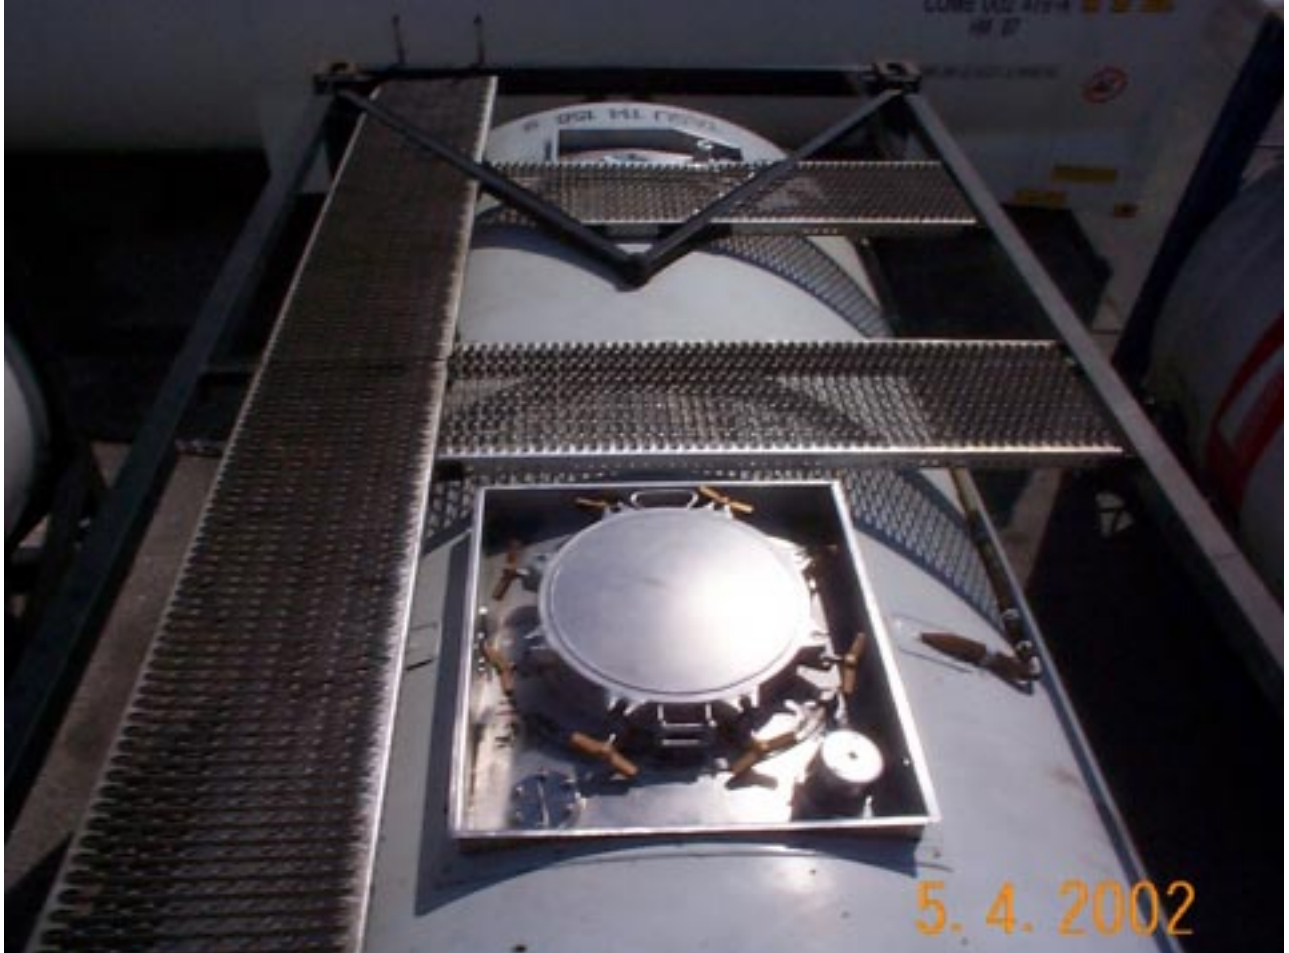









8. 4. 2002



8. 4. 2002



8. 4. 2002



8. 4. 2002



8. 4. 2002



8. 4. 2002